Non-Intrusive BMP Verification

Standard of Procedure

•	<	Formatted: Font: 12 pt, Not Bold
		Formatted: Default, Left, Line spacing: single
•	<	Formatted: Font: 12 pt
VERSION 65.0	$\langle \rangle$	Formatted: Default, Left, Line spacing: single
August 11, 2023		Formatted: Centered, Indent: First line: 0"
	$\overline{\ }$	Formatted: Font: 12 pt
	$\langle \rangle$	Formatted: Default, Centered, Indent: First line: 0", Line spacing: single
		Formatted: Font: 12 pt
Prepared By:	\checkmark	Formatted: Default, Indent: First line: 0", Line spacing: single
Larson Design Group		Formatted: Font: 12 pt
		Formatted: Default, Indent: First line: 0", Line

Joshua E. Glace and Teah E. Gray

Reviewed By:

Pennsylvania Department of Environmental Protection (DEP)

Jill Whitcomb, Kathryn Beats, Kristen Wolf, Erin Penzelik, Scott Heidel, Kathryn Bresaw

Independently Reviewed By:

Tetra Tech

Jon Harcum, PhD

Formatted: Font: 12 pt

spacing: single

Formatted: Default, Line spacing: single

Adopted By:

Clinton County Conservation District

Lackawanna County Conservation District

Luzerne Conservation District

Susquehanna County Conservation District

Potter County Conservation District

Presented to the Agricultural Workgroup on:

July 20, 2023

	Formatted: Font: 12 pt
	Formatted: Default, Left, Line spacing: single
	Formatted: Font: (Default) Calibri, 12 pt, Font color: Black
-	Formatted: Font: 12 pt
	Formatted: Default, Line spacing: single

Page 1 of 76

Abstract

Non-Intrusive Best Management Practice (BMP) verification is the process of using publicly accessible data and observation methods to identify and verify the functionality of targeted agricultural conservation practices, also known as Best Management Practices (BMPs), without intruding on the privacy of landowners. The methodology for this program uses publicly accessible data, remote imagery interpretation, historical practice implementation documents, and observations from public roadways to confirm and identify a BMP is present and functioning as intended. By using this methodology, certain BMPs can be collected and verified in a reduced timeframe and at a reduced financial cost, while also not requiring any release of private records by the landowner.

Scope

Multiple Conservation Districts within the Northern Tier of Pennsylvania have identified a need for the creation of a BMP verification program that can be conducted with non-invasive methods. Conservation Districts within Clinton, Potter, Lackawanna, Luzerne, and Susquehanna Counties recognized this priority through the adoption of the Commonwealth of Pennsylvania's initiative to document, verify, and report implemented BMP projects for enhanced accuracy of environmental nutrient and sediment reduction calculations. This pilot program contains an established focus to limit the amount of additional staff time dedicated towards the identification, collection, and documentation, while also limiting the reporting of private information required for BMP verification completion.



Counties included in Non-Intrusive BMP Verification Pilot Program are Clinton, Potter, Lackawanna, Luzerne, and Susquehanna.

Through the prioritization of BMP verification throughout Pennsylvania, the Department of Environmental Protection has utilized the Pennsylvania Clean Water Academy to release various tools and resources derived from the U.S. Environmental Protection Agency's (EPA) Chesapeake Bay Program Office (CBPO) to ensure approved verification methods would beare utilized throughout the Commonwealth. The establishment of the Non-Intrusive BMP Verification Program originated from the supplied resources and provides a procedural outline for Conservation Districts to utilize while completing BMP verification efforts to ensure proper data recording and landowner confidentiality.

BMP practices that were identified by the project as being best adapted for identification utilizing non-intrusive methods consist of six (6) Resource Improvement (RI) BMP practices outlined within the Chesapeake Bay RI Practice Definitions and Verification Visual Indicators Report (Table 1). This report is provided by the Pennsylvania Clean Water Academy's guidance materials for statewide BMP verification procedures. Please see Table 1 for the complete list of RI practices prioritized for verification within this program.

Page 3 of 76

Throughout this project, there is a combination of both re-verified existing BMP¹/₂ practices and the discovery of new practices. Existing practices were collected from Conservation District and DEP files from programs over the last 30 years. As with both newly discovered and re-verified practices, the project only focused on the outlined <u>six (6)</u> RI practices. It is important to note that these practices do not require an owner interview as part of the verification process.

Traditional Process Limitations

Traditional verification methods for BMPs involve formal onsite inspections and landowner interviews to record practice information. This process often involves various outreach methods to accommodate landowner schedules and availability. Due to the increased amount of part-time agricultural operators, this process sometimes needs to be completed on their days off or evenings, which presents challenges for Conservation District staff as they are also operating outside of their normal work hours. Once onsite, the information that is attained is not always accurate due to poor record-keeping or a lack of insight. This leads to increased time onsite and may also result in the need for follow-up visits to acquire additional documentation.

Utilizing third parties to complete BMP verification to reduce full-time governmental staff obligations and yet to complete the necessary workload is also another option. However, third-party individuals do not have the authority to enter private property, and increased coordination with those individuals is required to achieve such access. Private landowners also retain the right to tell the third-party they are not allowed access. It is often difficult to receive approval for site access by a third-party entity without the accompaniment of governmental staff to ensure the security of the collected data and the legitimacy of the visit.

The Non-Intrusive BMP Verification procedure creates a partnership between governmental staff and third-party staff to ease workload while providing property access and landowner reassurance.

Qualified Professionals for the Methodology

Qualified individuals to complete this process consist of Group 1 and Group 2 professionals outlined within the On-Site BMP Verification Guidelines for Counties provided by the DEP Chesapeake Bay Office Ag Compliance Section. Please note that the qualifications outlined below can be achieved by governmental staff as well as third-party staff for the completion of this procedure.

Guidelines for Group 1 and Group 2 Qualified Professionals are outlined below as stated within the On-Site BMP Verification Guidelines for Counties, which are made available on the Pennsylvania Clean Water Academy.

Guidelines for Group 1 Qualified Professionals

<u>Qualification Criteria:</u> Individuals who may be considered Group 1 Qualified Professionals should have:

- Sufficient on-the-job training, with <u>a</u> former or current Natural Resources Conservation Service (NRCS) Job Approval Authority, or
- Have attended NRCS trainings such as the Conservation Planner Certification Curriculum, NRCS Basic, Agronomy, and/or Engineering Bootcamps (Levels 1 and 2), or the State Conservation Commission Nutrient Management Certification series.

Verifiers will have relevant training and experience in identifying the existence and visual identification of BMP functions. When possible, Group 1 Qualified Professionals should rely on their knowledge and familiarity with the standards and specifications in NRCS's Field Office Technical Guide (eFOTG), though when appropriate, Group 1 Qualified Professionals may verify RI Practices according to the *Chesapeake Bay Program Resource Improvement Practice Definitions and Verification Visual Indicators Report* (Attached).

Training Activities

 Agriculture Conservation Level II – BMP Verification on the DEP Clean Water Academy (CWA), <u>https://pacleanwateracademy.remote-</u> learner.net/totara/program/view.php?id=26

Verification Activities

- Verification of the county's priority BMPs according to NRCS standards and specifications found in eFOTG.
- On-Site BMP and Plan Verification Checklist (attached) should be used as a checklist to verify plan and BMP verification on the operation during the site visit.
- If RI practices are verified, the applicable RI checklists found in the Chesapeake Bay Program Resource Improve Practice Definitions and Verification Visual Indicators Report should be completed during the site visit.
 - a. If BMPs are verified as an RI practice rather than an equivalent NRCS practice, the practice will require re-verification upon expiration of the credit

duration of the RI practice, which is generally half the credit duration of the equivalent NRCS practice.

 If the verification includes an assessment of NRCS standards and specifications, the verifier should rely on the appropriate documentation found in eFOTG and attach the documentation as applicable.

Guidelines for Group 2 Qualified Professionals:

Staff that do not meet the qualification criteria described under Group 1 Qualified Professionals should attend the following training activities. Once the training activities listed below are complete, staff will be considered Group 2 Qualified Professionals and should focus on the BMP verification activities listed below.

Training Activities

- Agriculture Conservation Level I New Staff Training on the DEP CWA, https://pacleanwateracademy.remote-learner.net/totara/program/view.php?id=21
- Agriculture Conservation Level II BMP Verification on the DEP CWA, https://pacleanwateracademy.remote-learner.net/totara/program/view.php?id=26
- 3. At least 40 hours of relevant on-the-job training and job shadowing by experienced professionals.

Verification Activities

- 1. Data entry of Manure Management Plans and Ag E&S Plans, verified as complete by experienced staff, into the Practice Keeper database
- 2. Data entry of BMPs into the Practice Keeper database
- Verification of RI practices identified as priorities in the county's County Wide Action Plan (CAP)
- 4. On-Site BMP and Plan Verification Checklist (attached) should be completed during the site visit.
 - a. The Group 2 Qualified Professional should rely on the determinations of administrative completeness completed by experienced staff when completing the On-Site BMP and Plan Verification Checklist.
- The applicable RI checklists found in the Chesapeake Bay Program Resource Improve Practice Definitions and Verification Visual Indicators Report should be completed during the site visit.

This pilot program was completed within the State of Pennsylvania and complies with the existing Pennsylvania State Agricultural Training Programs as provided through PA <u>Pennsylvania</u> DEP, PA-Pennsylvania Department of Agriculture, NRCS, and other associated training organizations. If this methodology is adapted for utilization within states outside of Pennsylvania, comparable training or experience should be substituted to meet qualifications for both Group 1 and Group 2 professionals.

Please note that although the outlined trainings for qualified Group 1 and Group 2 professionals isare not specific to the identification and verification of practices via remote sensing and aerial review, the outlined trainings do provide training on practice specific field and visual indicators to ensure proper practice functionality. Field and visual indicators outlined within the above trainings were utilized in partnership with the Chesapeake Bay Program Resource ImprovementRI Practice Definitions and Verification Visual Indicators Report to ensure proper practice conditions and operation and maintenance activities at each practice location during field verification.

As the utilization of Group 1 and Group 2 professionals varies within the execution of this methodology, the below chart depicts the responsible parties for the completion of the outlined pilot program. <u>Group 1 professionals are tasked with making all final determinations of practices</u> while utilizing this methodology.

Responsibility	Group 1	Group 2	Responsible
	Qualified	Qualified	Party for SOP
	Professional	Professional	Completion
Utilize Aerial Imagery Platform to	х	х	CCD, LDG
identify possible BMP locations.			,
Record possible BMP locations within	х	х	CCD, LDG
the Aerial Imagery Platform.			,
Complete Non-Intrusive Field	х	х	CCD, LDG
Verification efforts from publicly			,
accessible roadways.			
Completed BMP Verification	х	х	CCD, LDG
Windshield Survey and report collected			,
data into Practice Keeper Database.			
Review and approval of Practice Keeper	х		CCD, PADEP
Database entries for final submittal.	~		000,11021
Program Management and Oversight	Х		CCD, LDG,
			PADEP

Responsible Parties during the completion of the Non-Intrusive BMP Verification Pilot Program.

Formatted: Font: (Default) Arial, 11 pt
Formatted: Default
Formatted: Font: (Default) Arial, 11 pt

Formatted: Font: (Default) Arial, 11 pt

Formatted: Font:

Formatted: Font: 12 pt, Not Bold

Formatted: Default

Page 7 of 76

Methodology

To support the Non-Intrusive BMP Verification Program, various tools were developed by Larson Design Group for assistance in locating, routing, collecting, verifying, and reporting purposes. The creation of such tools allows for a standard in functionality for entities to accurately capture, verify, and record data. The methodology for the application of the developed tools was provided through in-person training and is outlined below.

This pilot program methodology was developed for utilization within the northern Chesapeake Bay Region of Pennsylvania. This is a large area with agricultural activities scattered across the landscape. This trend in land use contributes to substantial driving time to travel to farms and properties within an agency's area. This methodology was developed to address this concern and allow coverage of large, expansive areas in a timely manner.

Although this methodology was created for a specific region of Pennsylvania, this program can be adapted to be utilized across various geographic areas. The tools constructed for program implementation can be utilized across the Chesapeake Bay with increased success in areas with minimal topography due to increased sight distance. This also can minimize re-verification efforts for BMPs that require more frequent visits by reducing the overall coordination time and removing the variable of changing landowners, where a new discussion and access permissions would need to be required.

The Non-intrusive BMP Verification methodology is a complete program that is designed to effectively and efficiently identify, review, and report specific BMPs. This methodology is required to visually inspect all BMPs. All steps of the methodology need to be followed in order to accurately record each BMP verification. Extrapolation of data collected utilizing the outlined methodology cannot be completed as it would impact the integrity of the Pilot Program results.

Various tools were created for utilization throughout this program to aid in data identification, tracking, collection, and reporting. Below are descriptions of the various tools employed for program completion.

Aerial Desktop Review

For a preliminary review of each county's landscape, an aerial desktop review was completed using a developed ArcGIS Map Portal. Mapping portals allow you to create a published version

Page 8 of 76

of an ArcGIS map through a web browser. The mapping portal platforms are created on a county level and hold county-specific data sets that are publicly accessible.

As most <u>C</u>ounties have historical reporting and practice implementation information on file, these documents were utilized to establish a set of previously implemented practices that were evaluated during the completion of this program. It was often the case that the governmental agencies had documentation of previous practices that received <u>outside funding forfinancial</u> <u>and/or technical assistance for</u> completion, though, due to the age of the practice's implementation, they were out of lifecycle or hadn't had a recent inspection completed. Practices identified within this documentation were added to the aerial desktop review platform for inclusion in Non-intrusive Field Verification.

The aerial desktop review platform is also utilized by governmental agencies as well as thirdparty individuals to identify additional potential practices throughout each county. Not only can multiple entities utilize the portal at the same time, but it is also updated in real time for increased efficiency between office and field workflows.

Layers utilized within the portal creation included aerial imagery, roadways, parcel lines, mapped streams, and county municipality boundaries. All map layers are county specific references to aid in the detection of BMP locations across each landscape.

The county mapping portals also contain a specialized subset of data specific to each county. Specialized subset data consists of items such as stream buffer zones, a grid layer, and layers relative to land use type and/or parcel size. The stream buffer zone shapefile was created to display a 35-foot buffer zone around all mapped waterways within each county. This layer allows the user to identify buffer zones less than or greater than 35 feet without having to measure each potential buffer zone.

The inclusion of the associated county grid overlay allows the user to track progress within areas of the map that have been assessed for aerial BMP identification. Each grid cell can be marked as assessed so that multiple users can keep track of areas of the county that have not been evaluated. Layers for categorized land use or parcel size were requested by multiple counties to assist with the prioritization of verification areas due to their county size. Counties utilized this data layer to set priorities, such as parcels greater than 40 acres in size or parcels

Formatted: Font: 12 pt
Formatted: Default, Line spacing: single

Formatted: Font: 12 pt
Formatted: Default, Line spacing: single

that are deeded for agricultural land use. The inclusion of this data subset created another tool for workflow efficiency within counties that display large amounts of agricultural activity.

Practices targeted for verification through aerial desktop review included six (6) RI BMP practices outlined within the Chesapeake Bay Program's RI Practice Definitions and Verification Visual Indicators Report. The six (6) targeted practices for aerial identification through Non-Intrusive BMP Verification were selected based upon their compliance with completing field verification with minimal to no requirement for landowner interviews. These practices consist of Grassed Nutrient Exclusion Area on Watercourse (RI-7), Grass Buffer on Watercourse (RI-8), Forest Nutrient Exclusion Area on Watercourse (RI-9), Forest Buffer on Watercourse (RI-10), Barnyard Clean Water Diversion (RI-16), and Watering Trough (RI-18).

To assist with practice identification within the Aerial Desktop Review Platform, each platform contains toolbars to allow the functionality to measure, analyze, and mark possible BMP locations. BMP pins can be placed within the mapping portal to depict possible practice locations and can be coded by practice type. Each pin placement within the map portal is recorded into the mapping portal database for future navigation to each practice for field verification.

Implementation dates of the targeted practices are identified with the use of historical imagery within the aerial review platform through the depiction of a change or conversion of land use or landscape. If the landowner was available to provide an estimated date of practice implementation, that date was utilized for practice implementation over the aerial imagery date. If the practice was unable to be determined by historical imagery, as the resolution often provides limited ability to depict the presence or absence of older practices, practices were recorded with an implementation date of the date the practice was visited. By completing the BMP verification in this manner, it allows the county to document the practice is functioning and assign the practices the appropriate timeframe for re-verification inspections.

All identified practices are also reviewed through Practice Keeper and hard copy files to verify the practice data is not currently existing and if the practice was part of a cost sharing program provided by a state or local government agency. By reporting these historical practices, it records that the practice is present and functioning as intended, even though it may be outside of its original BMP lifecycle. The verification of this practice considers the date the inspection was completed to establish the renewed lifespan of the practice and ensure that continuous inspections occur on an appropriate timeline for each practice type.

Each of the six <u>(6)</u> targeted practices for verification through this methodology contains aerial review checkpoints to help with identification within the aerial mapping platform. Third-party individuals and governmental agencies utilize these checkpoints to assist with determining potential BMP locations within the aerial mapping platform, <u>which and</u> are provided below.

Grassed Nutrient Exclusion Area on Watercourse RI-7 & Grass Buffer on Watercourse RI-8

The identification of a Grassed Nutrient Exclusion Area on Watercourse or Grass Buffer on Watercourse consists of a similar visual observation within aerial imagery. Both practices are depicted along a stream or aquatic feature that does not display disturbance from livestock or machinery and does not contain more than 50% canopy cover. This indicator is often easily displayed on aerial imagery taken during the growing season, as any disruption to the vegetation will create a contrast between a disturbance and its intended use. Once an area of grass buffer is identified, it will be classified as RI-7 if it is between 10 and 34 feet in width, or RI-8 if it is greater than 35 feet in width. This width measurement can be approximated based on the aerial desktop review measure tool, with confirmation of width occurring during non-intrusive field verification.

The visual indicators outlined within the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report for RI-7 and RI-8 will be observed and recorded within the developed data collection forms during the onsite windshield survey at each practice location.

Forest Nutrient Exclusion Area on Watercourse RI-9 & Forest Buffer on Watercourse RI-10

The identification of a Forest Nutrient Exclusion Area on Watercourse or Forest Buffer on Watercourse consists of a similar visual observation within the aerial review platform. Both practices will be depicted along a stream or aquatic feature that contains a canopy cover greater than 50%. The vegetation within this buffer type consists of woody trees and shrubs that are naturally regenerated or planted. The indication of a forested buffer system along aquatic resources is best observed by the overlay of the Mapped Streams layer with forested, leafy vegetation within the aerial imagery. It is useful to utilize the mapped streams layer as stream

Formatted: Underline

Formatted: Underline

features are often difficult to see within aerial imagery layers taken during the growing season in areas that do contain greater than 50% canopy cover.

The visual indicators outlined within the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report for RI-9 and RI-10 will be observed and recorded within the developed data collection forms during the onsite windshield survey at each practice location.

Barnyard Clean Water Diversion RI-16

A Barnyard Clean Water Diversion is identified within the aerial imagery platform by the presence of a barn structure. Due to the nature of this practice and limitations on consistent indication or poor aerial image resolutions, barn structures were identified and visited to complete non-intrusive field verification of this practice.

Barn structures identified within the aerial imagery were visited from the closest public roadway to record the presence or absence of barnyard clean water diversion practices at each site. The visual indicators outlined within the Chesapeake Bay RI Practice Definitions and Verification Visual Indicators Report were followed during the completed field verification.

Watering Trough RI-18

The identification of a Watering Trough system within the aerial imagery platform was located through the presence of a pasture or grazing system. Due to the nature of this practice and limitations on consistent indication or poor aerial image resolution, pasture and grazing systems were identified and visited to complete non-intrusive field verification as per the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report guidelines for the Watering Trough practices.

Driving Route Creation

The mapping portal database located within the aerial review platform can be utilized to develop a driving route to field-verify each practice appropriately. The creation of driving routes for field practice verification efforts is an optional step within this procedure; however, this step has been found to increase program implementation efficiency.

The $\oplus \underline{E}$ xcel database located within the Aerial Desktop Review Platform was utilized to create these routes, as this table can be reordered by any of the column headings, such as

Formatted: Underline

Formatted: Underline

Page 12 of 76

municipality or latitude and longitude, to export an organized excel data set. This data set was then used to develop a consecutive list of verification sites to ensure efficient routing was established. Routing has been found to be most effective when organized by municipality to ensure repetitive travel on roadways is minimized.

In addition to driving route creation, each aerial desktop review portal can be opened within an application called ArcGIS Field Maps. This application allows you to view the aerial desktop map on a compatible mobile device or tablet and navigate to each identified BMP utilizing a navigation application such as Google Maps.

A combination of qualified Group 1 and Group 2 staff were involved in the completion of the driving route creation as well as field inspection visits.

Data Collection Forms

Data collection forms were created through <u>the</u> utilization of the Survey123 Application. Survey123 is a web-based, form-centric application employed for field survey and data collection processes for various in-field tasks. The Survey123 Data Forms can be customized for specified requirements for any given project and can be accessed through the Survey123 App on a compatible mobile device or tablet. Please see Figure 1 for an example of the developed data collection forms.


Survey123 Data Forms created for utilization through the Non-Intrusive BMP Verification Program were developed for each BMP type outlined within the Chesapeake Bay RI Practice Definitions and Verification Visual Indicators Report. Please see Table 1 for a list of these practices.

Field data forms were constructed in reference to the verification checklists and visual indicators outlined within the Chesapeake Bay RI Practice Definitions and Verification Visual Indicators Report, as well as the sample data collection forms provided by Franklin County Conservation District that received approval for program utilization through the DEP Chesapeake Bay Office.

All data collected within the Survey 123 Data Forms was reviewed and approved by a Group 1 professional before being recorded into the Practice Keeper Database.

Procedure

Through the utilization of the tools listed prior, a five-step procedure was created to locate, record, verify, report, and review the six (6) targeted RI practices for Non-Intrusive BMP Verification.

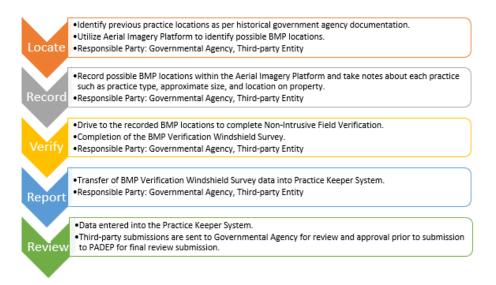

Step 1 – Locate

The first step in Non-Intrusive BMP Verification is to locate possible BMPs on the existing landscape. This process is completed utilizing historical governmental agency documentation as well as aerial desktop review through the utilization of the developed Aerial Desktop Review Platform.

As most Counties have historical reporting and practice implementation information on file, these documents were utilized to establish a set of previously implemented practices that were evaluated during the completion of this program. It was often the case that the governmental agencies, such as the Conservation District or DEP Regional eOffice, had documentation of previous practices that received eutside fundingfinancial and/or technical assistance for completion, though, due to the age of the practice's implementation, they were out of lifecycle or hadn't had a recent inspection completed. Practices identified within this documentation were added to the aerial desktop review platform for inclusion in Non-intrusive Field Verification.

The <u>Desktop</u> Aerial <u>Desktop</u> Review Platform is a secondary source for locating potential BMP locations and is accessible through a web browser for each specified county. This platform utilizes the most current aerial imagery to be viewed at various scales to aid with identifying specified practice types on the landscape.

<u>A</u>The aerial imagery utilized was provided by ESRI Wayback World imagery base mapping. This Imagery is tiled at various scales from various sources, most of which take advantage of satellite flight, although some of the data is derived from <u>aircraftPlanes</u>. The Wayback base map compiles all available aerial imagery layers to provide the most up-to-date data set for reference based on the location of the practice. The Imagery dataset_-utilized to determine current land use throughout the pilot program is dated 01/12/22.

Historical aerial imagery can also be referenced during this step to form comparisons and depict changes in land use or the estimated date of implementation or construction of a new practice. Throughout this procedure, historical imagery was utilized only when an implementation date for a practice was unknown by the verifier and by the landowner. Historical imagery used to determine practice implementation dates did not predate 1994 due to imagery clarity.

The sources of the aerial imagery data set are sited to Esri, Here, Garmin, SafeGraph, GeoTechnologies, METI/NASA, USGS, Bureau of Land Management, EPA, NPA, US Census Bureau, and USDA.

Identification of aerial signatures was completed by qualified Group 2 professionals with oversight and approval by qualified Group 1 professionals. Remote sensing and aerial photo standards are common practices throughout this procedure for identifying signatures on the landscape that may indicate specific practices or structures.

During practice identification, practice sites were pre-screened to remove locations that would have limited access or visibility during the field verification step. This pre-screening limited extra drive time and ensured that most practices recorded for field verification could be seen from a public roadway. Pre-screening criteria allowed for the removal of sites with practices that were greater than 1000 feetfrom a public roadway, or sites that contained heavy canopy cover. Topography was not utilized to negate sites as elevation visibility varies greatly based on vegetative cover, although, topography did Formatted: Font: 12 pt

Formatted: Default, Line spacing: single

Formatted: Font: 12 pt

Formatted: Default, Line spacing: single

Formatted: Font: 11 pt Formatted: Default

Formatted: Font: 11 pt Formatted: Font: 11 pt

Page 15 of 76

pose the most significant set-back from seeing practices from public roadways during the field verification step.

Step 2- Record

The second step of the procedure is to record potential practices that are identified in the aerial imagery. This will be completed by qualified Group 2 professionals with oversight and approval from Group 1 professionals. This task can be accomplished through the Aerial Desktop Review Platform by starting an edit session and placing pins at the determined practice locations. The "Edit" toolbar within the platform will be utilized to allow a "Resource Improvement" pin to be dropped at the approximate practice location on the landscape. Once the pin is placed on the map, a pop-up dialogue will appear, which will be filled in with site and practice specifics. The data collected within this dialogue will be recorded into the platform's database in correlation to each RI practice pin. Information collected within this dialogue includes preliminary data such as municipality, latitude and longitude, practice type, <u>practice size</u>, and associated practice notes₂.⁻⁻, <u>During this step</u>, practices are measured utilizing the measure tool within the Aerial Desktop Review Platform. The measurement of the practice can be calculated in various units, such as linear feet or acres, for the various practice types. Measurements that are recorded during this step are referenced during the completion of Step 3 to confirm practice measurements are accurate, or are field adjusted to reflect current practice conditions.

Formatted: Default, Space Before: 0 pt

Formatted: Space Before: 0 pt

Formatted: Font: (Default) Arial, 11 pt
Formatted: Default
Formatted: Font: (Default) Arial, 11 pt
Formatted: Font: (Default) Arial, 11 pt
Formatted: Font:

Page 16 of 76



Aerial Review Platform with riparian buffer zone identified for further non-intrusive field verification.

Step 3- Verify

The next step after preliminary data recording is to complete field verification. Please note that the verification procedures outlined within this program are provided to complete this step with minimal to no intrusion onto private property.

All data recorded into the Aerial Review Platform can be exported in the form of an Excel sheet from the "Table" Tool located within the platform for utilization during this step. Once the data is exported, it can be organized to form a driving route based on the municipality and latitude and longitude of each BMP pin. It is good practice to create a separate driving route per municipality so that field verification is completed efficiently.

Page 17 of 76

Farm Operation Resource Improvements Lackawanna County Grid								:: 0	0 5 8
	-Municipality 0	Field Verificatio 0	Location 0	Latitude 0 ····	Longitude 0	Practice Type 1 0	Practice Type Z 1 ····	Practice Type 3 1 ····	Practice Type
	FELL	No	Approximately 1200 feet I	41.608262	-75.537663	Riparian Forest Buffer (Ri-9, Ri-10, Ri-12)			
1	FELL	No	Approximately 3000 feet I	41.614567	-75.534144	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
τ.	FELL	No	Approximately 1000 feet I	41.616817	-75.528964	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
r.	FELL	No	Approximately 900 feet lo	41.597929	-75.543041	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
r i	FELL	No	Approximately 2000 feet I	41.593726	-75.547979	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
t.	SCOTT	No	Approximately 1600 feet I	41.586577	-75.619084	Riparian Herbaceous Cover aka Grass B			
ť.	SCOTT	No	Approximately 1200 feet I	41.587512	-75.612673	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
r.	SCOTT	No	Approximately 1400 feet I	41.586104	-75,595673	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
ť,	SCOTT	No	Approximately 1500 feet I	41.574695	-75.656138	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
ť,	SCOTT	No	Approximately 900 feet lo	41.583480	-75.629778	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
ř.	SCOTT	No	Approximately 1300 feet I	41.580388	-75.632375	Riparian Herbaceous Cover aka Grass B			
i)	SCOTT	No	Approximately 800 feet lo	41.573234	-75.639443	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
	SCOTT	No	Pond	41.581546	-75.621644	Riparian Herbaceous Cover aka Grass B			
ł.	SCOTT	No	Pond	41.579842	-75.615613	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
i.	SCOTT	No	Approximately 900 feet lo	41.574802	-75.605175	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
r.	SCOTT	No	Pond	41.583370	-75.601016	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
ŧ,	SCOTT	No	Pond	41.582641	-75.595709	Riparian Herbaceous Cover aka Grass B			
	SCOTT	No	Pond	41.583367	-75.591918	Riparian Herbaceous Cover aka Grass B			
ł,	SCOTT	No	Pond	41.573949	-75.596575	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
ł.	SCOTT	No	Entire lakeshore.	41.578718	-75.587886		Riparian Forest Buffer (RI	Riparian Herbaceous Cov	
i.	SCOTT	No	Approximately 3200 feet I	41.570405	-75.564604	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
	SCOTT	No	Approximately 2500 feet I	41.568871	-75.583003	Riparian Forest Buffer (RI-9, RI-10, RI-12)	Riparian Herbaceous Cov		
	SCOTT	No	Approximately 1000 feet I	41.564436	-75.589353	Riparian Herbaceous Cover aka Grass B			
	SCOTT	No	Pond	41.566344	-75.581130	Riparian Forest Buffer (RI-9, RI-10, RI-12)			
į.	SCOTT	No	Approximately 1200 feet I	41.567516	-75.598981	Riparian Herbaceous Cover aka Grass B			

Aerial Desktop Review Table for creating driving route.

The developed driving route Excel sheets or ArcGIS Field Maps application tables are utilized to find and navigate to each practice site. If utilizing a driving route, coordinates are placed into a dashboard GPS system to ensure public roadways are utilized while accessing each site.

Once it is safe to do so, the vehicle is parked along the closest public roadway that allows the practice to be visible to the verifier. If the practice cannot be seen from the closest public roadway, that practice cannot be verified and cannot be reported as an implemented and verified practice unless a landowner interview occurs and direct onsite access is provided. Practices that are being visually verified are within 1000 feet of the closest roadway. Based on the specific practices, the distance thatat which the practice can be verified from the road may vary. Depending on the vantage point of the visual inspections, the distance at which practices can be identified will vary. —The use of binoculars can aid in the visual inspections and also assist in determining the functionality of any practice. At this point, it is the responsibility of the Group 1 individual to determine if the if all visual indicators can be seen and verified at any distance.

If the practice can be seen from the closest public roadway, BMP practice information is collected utilizing the established Survey123 Online Data Forms. After all visual indicators that

Page 18 of 76

ensure the practice is functioning properly can be confirmed, a data form will be completed and submitted for that practice. Please see Figure 1 for an example of a Survey 123 Online Data Form.


A Survey123 Online Data Form will be completed for each practice that is recorded and verified and is set-up to collect information specific to each RI practice type. The proper data form will be selected within the drop-down dialogue of the Survey123 Online Data Form and can be filled in based on the definitions, checklist, and visual indicators listed within the Chesapeake Bay Program RI Practice Definitions and Visual Indicators Report. If practice information cannot be answered confidently₇ and/or data outlined within the aforementioned report cannot be provided, the practice cannot be recorded at that time unless a landowner interview occurs₇ and onsite access is provided.

Practices that are successfully verified will have all data collected based on the visual indicators and associated practice checklist. Each data form will be submitted electronically to the online ArcGIS Hub Site.

This step can be completed by a qualified Group 2 professional with oversight and approval from a qualified Group 1 professional. <u>Additional practices that are observed in the field but not</u> <u>during Step 1, can be collected as well. While visiting sites any of the 6 RI practices that all</u> <u>visual indicators can be observed can be added during the survey.</u>

Step 4 - Report

Data forms that are submitted through the Survey123 application get returned electronically to the online ArcGIS Hub Site. The data forms populated within the Hub Site are then downloaded by county and stored within an external Excel-oriented database. Each county database contains additional columns for data review and data entry tracking to ensure reporting quality. Additional tracking material includes information such as the practice submission date, submission entity, and status of submission approval.

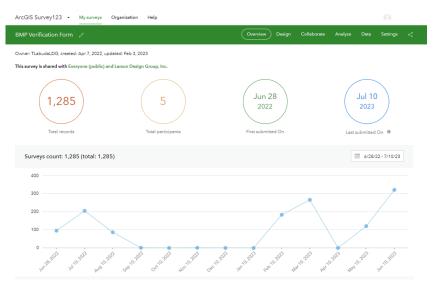

ArcGIS Hub Site

All practices verified through this program are entered into Pennsylvania's BMP collection database, Practice Keeper, for recording purposes. All Practice Keeper reporting efforts were completed by qualified Group 2 professionals with oversight and approval from qualified Group 1 professionals.

The Practice Keeper Portal requests specific information about each practice to ensure proper reporting. In order to keep data reporting consistent, the information required by Practice Keeper was utilized in the creation of the Survey123 Data Forms. Below is a comparison of the information recorded by the Practice Keeper Portal as well as the Survey123 Data Forms.

Page 20 of 76

Question	Practice Keeper	Survey123 Online
		Data Form
Landowner Name	Х	Х
Practice Type	Х	Х
Practice Subtype	Х	Х
Practice Status	Х	Х
Latitude/Longitude	Х	Х
County	Х	Х
Address	Х	Х
Planned On	Х	Х
Implemented On	Х	Х
Conservation Plan Details	Х	Х
Practice Measures	Х	Х
Funding Type	Х	Х
Photos	Х	Х
RI-Checklist Questions		Х

Practice Keeper and Survey123 Data Collection Comparison

Practices that have been entered into Practice Keeper by a third-party entity are submitted through a partnership portal to the associated governmental agency for final review. The qualified Group 1 governmental agency staff then must review and approve the practice before final submittal to the Sstate.

The Practice Keeper Database has an established Standard of Procedure to ensure the quality of data reporting. This <u>Standard Operating Procedure (SOP)</u> was utilized and referenced throughout the completion of the Non-Intrusive BMP Verification Pilot Program.

Page 21 of 76

< C ⋒ 6	- C A D https://prod.practicekeeper.com/#/entity/Partner8mpInstance								
Dashboard	Dashboard Partner Modules Data Export Reports								
Larson Design Group: Partner Bmp Instance Partner Conservation Plan Search Partner Nutrient Management Plan						Search			
Identifier	Identifier Submissio			Practice	Practice Subtype	Status	Hydrologic Unit Code		
	x		×	x	x	x			
DPBMP-LDG-01016		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020502040305		
DPBMP-LDG-01015		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020502040305		
D PBMP-LDG-00875		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020501070305		
DPBMP-LDG-00874		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020501070305		
DPBMP-LDG-00873		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020501070305		
DPBMP-LDG-00872		Approved		Riparian Forest Buffer	RI-9 Forest Nutrient Exclusion A	Implemented	020501070305		
D PBMP-LDG-00871		Approved		Riparian Forest Buffer	RI-10 Forest Buffer on Watercour	Implemented	020501070304		

Third-Party Partner BMP Instance Portal

Step 5 - Review

After the entry of the BMP into the Practice Keeper System, the BMP instance is submitted to the associated governmental agency for qualified Group 1 professionals to review. This procedure ensures that the practices that are entered are accurate and confirms that this is not an existing practice in the Practice Keeper database to prevent duplication of record submissions. All practices have required data that needs to be entered in order to receive credit for the BMP. Any accuracy issues with the recorded BMPs are rejected and sent back to the partnership portal to be corrected and re-submitted for review. Any identified duplicate practices are removed from the Practice Keeper system.

Results

Upon the conclusion of the Non-Intrusive BMP Verification Pilot Program, a case study was performed to ensure program sufficiency. The case study was conducted by completing an onsite inspection at a minimum of 10% of the Non-Intrusive Field Verified BMP locations. As 810 BMP locations were verified through the utilization of this pilot program, 81 sites were then inspected via traditional on-site inspection methods.

Traditional on-site inspections were completed by a third-party while accompanied by the appropriate governmental agency, as third-party contractors do not have the authority to access private property without consent from the landowner.

Page 22 of 76

The traditional on-site inspections were completed at previous non-intrusive, verified BMP locations via random selection. As per the traditional inspection methods, the landowners associated with the location of each of the 81 BMPs were contacted via mail or phone prior to the inspection to set up a field inspection date if possible. If no response was received, a range of possible field dates was provided to the landowner so they were aware someone from their County Conservation District would be visiting their property.

Of the contacted landowners, 20 responded to the letter or phone call to either determine a meeting time or deny access to their property. It was then assumed that the remainder of the contacted landowners had no issue with the presence of Conservation District Staff on site to complete the inspection on the range of possible dates provided.

After completing all 81 traditional on-site inspections, the field data forms were compared to determine if there was consistency between the traditional on-site inspection and the developed Non-Intrusive BMP Verification Pilot Program.

The comparison of this data was completed by cross-referencing the amount of data fields completed within the Survey123 Data Forms, which were used for both types of BMP verification, as well as the validity of the data collected by both methods.


After completing the comparison of the amount of data collected, the percentage of data form fields able to be completed during both verification methods remained relatively constant, with the exception of an updated landowner name being available during the traditional on-site inspections if the landowner was available, as well as more detailed BMP photographs due to access to private property.

The comparison of the validity of the data collected also provided similar results between the traditional on-site inspection and the Non-Intrusive BMP Verification Pilot Program methodology. The validity of the data remained consistent with non-intrusive methods due to the limited contact with the landowner, even after reaching out to schedule field visits. <u>The D</u>data available for collection remained the same as what was available to the verifiers during the non-intrusive methods at the sites where landowners were not present.


Page 23 of 76

Differentiation of data availability occurred only at the properties where the landowner was available on site to have a meeting about the practice in question. This instance occurred at 20 of the 81 sites inspected using traditional on-site methods. Although the landowner was available, they often had minimal additional information to provide about the RI practices in question. Most practices were either implemented by the landowner voluntarily or by a previous owner had implemented the practices resulting in unknown implementation dates unless the landowner received funding for completion. There was little to no additional practice information provided by the landowner for the six (6) RI BMPs targeted for verification.

After this data collection comparison, it has been identified that even if landowner availability is confirmed, both methods achieve the same accuracy of data collection.

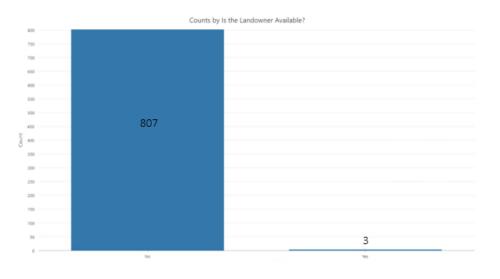

Landowner contact during Non-Intrusive BMP Verification - 4-1-2022 to 3-31-2023

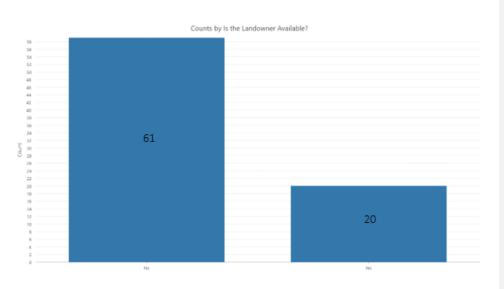

Landowner contact during Traditional BMP Inspection - 4-1-2023 to 7-12-2023


 Formatted: Normal, Centered, Line spacing:	1.5
lines	

Overall data collection results were also evaluated through conducting analysis of the validity of
aerial identification methods as well as field verification methods, utilizing metrics considered to
assess overall methodology accuracy. Rates calculated for analysis consists of the False Alarm
Ratio (FAR), Hit Rate (HR), Critical Success Index (CSI), Post Agreement Rate (PAG), and
Proportion Correct (PC) (Schaefer 1990). Below is an explanation of the calculated metrics
used for procedure analysis. The base data for these calculations are slocated in Tables 2, 3,
and 4 with the appendix of the methodology. A Confidence Level of 95% was used for all
Confidence Interval for Proportions calculations Additional calculation metrics are located in
the tables below.

Formatted: Font: (Default) Arial, 11 pt
Formatted: Font: (Default) Arial, 11 pt

1	Formatted: Font: (Default) Arial, 11 pt
+	Formatted: Font: (Default) Arial, 11 pt

	Critical Success	False Alarm Ratio	Hit Rate	Post Agreement Rate	Proportion Correct	Frequency Bias
RI Practice Type	(CS)	(FAR)	(HR)	(PAG)	(PC)	(FB)
RI-7	0.76	0.24	1.00	0.76	0.76	1.32
RI-8	0.32	0.00	0.32	1.00	0.32	0.32
RI-9	0.38	0.62	1.00	0.38	0.38	2.61
RI-10	0.86	0.14	1.00	0.86	0.86	1.17
RI-16	0.93	0.00	0.93	1.00	0.93	0.93
RI-18	0.28	0.00	0.28	1.00	0.28	0.2



Formatted: Line spacing: 1.5 lines

Page 25 of 76

Confidence Interval for Proporations									
Departies Truns	p=Criterical S	uccess Index	Margin of Error	p=False Alarm Rate		p=Hit Rate		Manain of Funan	
Practice Type	Low	High	wargin of Error	Low	High	Margin of Error	Low	High	Margin of Error
RI-7	0.6224	0.8976	14%	0.1024	0.3776	14%	0.9579	1.0221	3%
RI-8	0.219	0.4271	10%				0.219	0.4271	10%
RI-9	0.2932	0.4668	9%	0.5332	0.7068	9%	0.9722	1.0078	2%
RI-10	0.8303	0.8852	3%	0.1148	0.1148	3%	0.9821	0.9979	1%
RI-16	0.8821	0.9779	5%				0.8821	0.9779	5%
RI-18	0.07258	0.4874	21%				0.07258	0.4874	21%

Formatted: Font: (Default) Arial, 11 pt

RI-7 (Grassed	Nutrient	Exclusion	Area,	Narrow

<u>Metrics calculated for the evaluation of Narrow Grassed Nutrient Exclusion Areas (RI-7)</u>, <u>displayed a Critical Success Rate of 0.76. This rate reflects a successful overall accuracy of</u> <u>observations that were confirmed on the ground level.</u>

The False Alarm Ratio FAR reflects the fraction of remotely detected projects that were not able to be confirmed during the windshield survey. For RI-7, this value is 0.24, as limited practices identified on aerial imagery were not able to be verified during an on-site inspection.

The Hit Rate (HR) factor indicates the fraction of remotely-detected BMPs that were confirmed or found through our windshield surveys. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found, For Narrow Grassed Nutrient Exclusion Areas, this value was calculated at 1.0.

RI-8 Grassed Nutrient Exclusion Area, Wide,

Metrics calculated for the evaluation of Wide Grassed Nutrient Exclusion Areas (RI-8), displayed a Critical Success Rate of 0.32. This rate reflects a low rate of the overall accuracy of observations that were confirmed through the windshield survey. This is due to a lower number of RI-8 practices identified on aerial imagery as compared to what was successfully observed through the windshield survey. This increased amount of verified RI-8 practices originated from practices that were identified on aerial imagery as an RI-7 practice but met the classification of an RI-8 practice during the windshield survey.

	Formatted: Font: 11 pt, Underline
-	Formatted: Underline
	Formatted: Default
	Formatted: Font: 11 pt
	Formatted: Default
	Formatted: Font: 11 pt
1	Formatted: Font: 11 pt
	Formatted: Line spacing: 1.5 lines
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
_	Formatted: Font: 11 pt
-	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Default
	Formatted: Font: 11 pt, Underline
$\left(\right)$	Formatted: Underline
	Formatted: Default
	Formatted: Font: 11 pt
-	Formatted: Font: 11 pt
	Formatted: Default

Page 26 of 76

The False Alarm RatioFAR, reflects the fraction of remotely detected projects that were not able to be confirmed during field verification. For RI-8, this value is 0, as all of the practices identified on aerial imagery were able to be verified during the windshield survey.

The Hit Rate (HR) factor indicates the fraction of remotely- detected BMPs that were confirmed or found through the windshield survey. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found. For Wide Grassed Nutrient Exclusion Areas, this value was calculated at 0.32. This value states that this practice was under identified on the windshield survey upon what was located during the aerial review.

RI-9 Forested Nutrient Exclusion Area, Narrow,

Metrics calculated for the evaluation of Narrow Forested Nutrient Exclusion Areas (RI-9)_T displayed a Critical Success Rate of 0.38. This rate reflects a low rate of the overall accuracy of observations that were confirmed on the windshield survey, This is due to a higher number of RI-9 practices identified on aerial imagery as compared to what was successfully verified on the windshield survey,

The False Alarm RatioFAR reflects the fraction of remotely detected projects that were not able to be confirmed during the windshield survey. For RI-9, a rate of 0.61 of the practices identified on aerial imagery were not able to be verified during the windshield survey. This percentage was reflected as high due to the majority of practices identified on aerial imagery as narrow forested buffers, being considered a wide forest buffers, when the windshield survey, occurred.

The <u>Hit Rate (HR)</u> factor indicates the fraction of remotely- detected BMPs that were confirmed or found through the windshield survey. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found. For Narrow Forested Nutrient Exclusion Areas, this value was calculated at 1.0.

RI-10 Forested Nutrient Exclusion Area, Wide

Metrics calculated for the evaluation of Wide Forested Nutrient Exclusion Areas $(RI-10)_{T}$ displayed a Critical Success Rate of 0.86. This rate reflects a successful overall accuracy of the observations that were confirmed on the windshield survey.

1	Formatted: Font: 11 pt
1	Formatted: Font: 11 pt
-	Formatted: Font: 11 pt
-	Formatted: Default

Formatted: Font: 11 pt

	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Default
$\overline{)}$	Formatted: Font: 11 pt, Underline
$\langle \rangle$	Formatted: Underline
$\langle \rangle$	Formatted: Default
/)	Formatted: Font: 11 pt
, \	Formatted: Space After: 0 pt, Line spacing: 1.5 lines
$\langle \rangle$	Formatted: Font: 11 pt
$\langle \rangle$	Formatted: Font: 11 pt
$\langle \rangle$	Formatted: Font: 11 pt
$\langle \rangle$	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
$\overline{)}$	Formatted: Font: 11 pt
$\langle \rangle$	Formatted: Font: 11 pt
	Formatted: Default
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Default
	Formatted: Font: 11 pt, Underline
	Formatted: Underline
	Formatted: Default
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Font: 11 pt
	Formatted: Default

Page 27 of 76

The False Alarm RationFAR reflects the fraction of remotely detected projects that were not able to be confirmed during the windshield survey. For RI-10, a rate of 0.14 of the practices identified on aerial imagery were not able to be verified during the windshield survey.

The Hit Rate (HR) factor indicates the fraction of remotely- detected BMPs that were confirmed or found through the windshield survey. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found. For Wide Forested Nutrient Exclusion Areas, this value was calculated at 1.0. This value states that all practices identified on aerial imagery were able to be verified on the windshield survey.

RI-16 Barnyard Clean Water Diversion

Metrics calculated for the evaluation of Barnyard Clean Water Diversion (RI-16), displayed a Critical Success Rate of 0.93. This rate reflects a successful overall accuracy of the observations that were confirmed on the windshield survey.

The False Alarm Ratio FAR reflects the fraction of remotely detected projects that were not able to be confirmed during the windshield survey. For RI-16, this value is 0, as all of the practices identified on aerial imagery were able to be verified during the windshield survey.

The Hit Rate (HR) factor indicates the fraction of remotely- detected BMPs that were confirmed or found through the windshield survey. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found. For Barnyard Clean Water Diversions, this value was calculated at 0.93. This value states that almost all practices identified via aerial imagery were able to be verified on the windshield survey.

RI-18 Watering Trough

<u>Metrics calculated for the evaluation of Watering Troughs (RI-18), displayed a Critical Success</u> <u>Rate of 0.28. This rate reflects a low rate of the-overall accuracy of observations that were</u> <u>confirmed on the windshield survey.</u> This is due to a lower number of RI-18 practices identified <u>on aerial imagery as compared to what was successfully verified on the windshield survey.</u>

1 pt
1 pt
1 pt
1 pt
t

Formatted: Font: 11 pt Formatted: Font: 11 pt

Formatted: Space After: 0 pt, Line spacing: 1.5 lines

Formatted: Font: 1	1 pt, Underline
Formatted: Underli	ne
Formatted: Default	:
Formatted: Font: 1	1 pt
Formatted: Line sp	acing: 1.5 lines
Formatted: Font: 1	1 pt
Formatted: Default	:
Formatted: Font: 1	1 pt

-	Formatted: Font: 11 pt
	Formatted: Default
	Formatted: Font: 11 pt, Underline
	Formatted: Underline
	Formatted: Default
Ϊ	Formatted: Font: 11 pt
-	Formatted: Font: 11 pt
-	Formatted: Font: 11 pt

Page 28 of 76

The False Alarm Ratio FAR, reflects the fraction of remotely detected projects that were not able to be confirmed during the windshield survey. For RI-18, this value is 0, as all of the practices identified on aerial imagery were able to be verified during the windshield survey.

<u>The Hit Rate (HR) factor indicates the fraction of remotely detected BMPs that were confirmed</u> or found through the windshield survey. HR values range from 0 to 1, with a value of 1 indicating all BMPs were found. For Watering Troughs, this value was calculated at 0.28. This value states that this practice was under identified on the ground based upon what was located during the aerial review.

Throughout the analysis, several results showed both <u>favorable and unfavorable metric calculations</u>. <u>However</u>, in the several of the RI practices, a limited data set is impacting this analysis. This <u>methodology is still valid</u>, and certain RI's can be verified utilizing this our verification method. It was <u>determined that some of the practices arewere not a successfully identified through the aerial imagery</u> <u>but cancould be verified while conducting the verification process for additional RI's practices. <u>Overall</u>, this methodology is <u>affective</u>effective onfor the identified RI practices.</u>

Formatted: Default Formatted: Font: 11 pt Formatted: Font: 11 pt Formatted: Font: 11 pt Formatted: Font: 11 pt Formatted: Default Formatted: Font: Arial Formatted: Not Highlight Formatted: Not Highlight Formatted: Default, Left Formatted: Not Highlight Formatted: Not Highlight Formatted: Font: (Default) Arial

Cost and Time Analysis

Below is an estimated time analysis comparison of the Non-Intrusive BMP Verification method and the traditional Field Inspection method. This comparison of average hours per task is based on the verification completion of 50 RI BMPs.

The timeframes depicted below are representations of the time needed to complete the BMP verification processes. Time commitments were taken from both government and third-party personnel to complete the methodology's timeframe estimation. Outside variables are present that could affect the averages outlined below. Possible variables include drive time, location of surveyed areas, existing data, and interactions with the landowner.

Page 29 of 76

Formatted: Font: 12 pt

.

Formatted: Default, Left, Line spacing: single

Non-Intrusive BMP Methodology

Task	Time Requirement – Per 50 BMP's	Comments
Database Development	24 Hours	Only needed at start of the program
Complete Aerial Review	4-hour average	Can differ based on concentration of farming operations. Includes base data collection
Complete Driving Routes	3 hours	
Windshield Survey	11-hour average	Includes drive time and form completion
Data Entry and Review	12-hour average	

Page 30 of 76

Total	54 Hours – 30 hours without Data	
	base development	

Page 31 of 76

Task	Time Requirement – Per 50 BMP's	Comments
Landowner Notification – Mailings, email, or calls	18 hours	Average 15 minutes per parcel with 50% needing a follow up communication.
BMP Identification	16 hours	Plan review or previously implemented BMP
Complete Inspections with Landowner	80 hours	Assume a 1.5-hour drivetime per day and 15 minutes between operations. Assuming 2 BMPs per site and 10 per day. Variable can occur and reduce number of site visits.
Data Entry and Review	12-hour average	
Total	126 hours	

Traditional Field Inspection

It was found that Non-Intrusive BMP methods can be completed in roughly 25% of the time needed for traditional field inspection. The negative aspect is that only about 75% of the BMP can be seen and verified from the road, whereas traditional inspection can account for every BMP.

To establish a cost analysis between the two methodologies, 810 BMPs were identified as part of the pilot program. Based on an average of hours, it would take roughly 550 hours to complete the Non-Intrusive BMP methodology and 1,920 hours to complete the traditional field inspection for the same 810 BMPs. When compared to an average 2,080-hour work year, that is 27% of a person's yearly job duties for Non-intrusive BMP verification and 92% of a person's yearly job duties for traditional field inspections.

Page 32 of 76

Conclusion

The Non-Intrusive BMP Verification methodology is an effective and cost-efficient protocol that can be used to capture Resource Improvement RI BMPs. This method can be utilized to collect new BMPs or reverify existing BMPs with the added functionality of data reporting consolidation within the Online ArcGIS Hub Site. This tool provides organization for agency staff and allows the ability to utilize third-party consultants to assist in the completion of this program. Although this methodology does vary from traditional inspection reporting, overall data collection and accuracy are comparable to traditional field inspection methods.

Formatted: Default, Line spacing: 1.5 lines

Page 34 of 76

Page 35 of 76

Page 36 of 76

References

Bureau of Clean Water, Standard Operating Procedure (SOP) Practice Keeper - Best Management Practice (BMP) Module SOP No. CBO-DATA-003 (2021). Department of Environmental Protection.

Ensor, R., Absher, D., Moore, G., Garber, L., McGee, B., Albrecht, G., Weibley, E., Wootton, C.,
& Hill, J. (2014). Appendix H - Chesapeake Bay Program Resource Improvement
Practice Definitions and Verification Visual Indicators Report. *Pennsylvania Clean Water Academy*. <u>PA Clean Water Academy (remote-learner.net)</u>

Formatted: Font: 11 pt

Pennsylvania Department of Environmental Protection. (n.d.). *Practicekeeper*. PracticeKeeper. <u>https://prod.practicekeeper.com/#/</u>

Schaefer, J.T. 1990. The critical success index as an indicator of warning skill. Weather and Forecasting. 5:570-575

Formatted: Font: 11 pt Formatted: Font: (Default) Arial, 11 pt Formatted: Default, Indent: Left: 0", First line: 0" Formatted: Font:

Tables

Table 1

Resource Improvement Practices

Code	Resource Improvement Practice Name	Additional Practice Information
RI-1	Dry Waste Storage Structure	
RI-2	Animal Compost Structure	
RI-3	Alternative Crop/Switchgrass	
RI-4A	Watercourse Access Control-Narrow Grass	10'-34' Width Exclusion Area, Natural Grass or planted
RI-4B	Watercourse Access Control-Narrow Trees	10'-34' Width Exclusion Area, Native Trees or planted
RI-5	Watercourse Access Control-Grass	35'+ Width Exclusion Area, Natural or planted Grass
RI-6	Watercourse Access Control-Trees	35'+ Width Exclusion Area, Natural or planted Trees
RI-7	Grass Nutrient Exclusion Area on	10'-34' Width Nutrient Exclusion Area
	Watercourse	
RI-8	Grass Buffer on Watercourse	35'+ Width Buffer
RI-9	Forest Nutrient Exclusion Area on	10'-34' Width Nutrient Exclusion Area
	Watercourse	
RI-10	Forest Buffer on Watercourse	35'+ Width Buffer
RI-11	Vegetative Environmental Buffer for Poultry-	Warm Season Grass
	Grass	
RI-12	Vegetative Environmental Buffer for Poultry-	Trees
	Trees	
RI-13	Conversion to Pasture	
RI-14	Conversion to Hayland	
RI-15	Rotational Grazing	
RI-16	Barnyard Clean Water Diversion	
RI-17	Water Control Structure	
RI-18	Watering Trough	

Page 38 of 76

Note: Table 1 refers to all RI Practices outlined within the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report. Six <u>(6)</u> of the practices outlined within this complete list were utilized throughout the identification, verification, and recording process of BMP locations reported within the Practice Keeper Database for nutrient and sediment load reduction calculations. The six <u>(6)</u> practices evaluated consisted of Grass Nutrient Exclusion Area on Watercourse (RI-7), Grass Buffer on Watercourse (RI-8), Forest Nutrient Exclusion Area on Watercourse (RI-9), Forest Buffer on Watercourse (RI-10), Barnyard Clean Water Diversion (RI-16), and Watering Trough (RI-18).

Page 39 of 76

Table 2

Verification Metrics

Code	Resource Improvement Practice Name	Verification Metrics
RI-1	Dry Waste Storage Structure	~
RI-2	Animal Compost Structure	~
RI-3	Alternative Crop/Switchgrass	~
RI-4A	Watercourse Access Control-Narrow Grass	~
RI-4B	Watercourse Access Control-Narrow Trees	~
RI-5	Watercourse Access Control-Grass	~
RI-6	Watercourse Access Control-Trees	~
RI-7	Grass Nutrient Exclusion Area on Watercourse	28
RI-8	Grass Buffer on Watercourse	82
RI-9	Forest Nutrient Exclusion Area on Watercourse	46
RI-10	Forest Buffer on Watercourse	527
RI-11	Vegetative Environmental Buffer for Poultry-Grass	~
RI-12	Vegetative Environmental Buffer for Poultry-Trees	~
RI-13	Conversion to Pasture	~
RI-14	Conversion to Hayland	~
RI-15	Rotational Grazing	~
RI-16	Barnyard Clean Water Diversion	109
RI-17	Water Control Structure	~
RI-18	Watering Trough	18
	Total Practices Verified	810

Page 40 of 76

Note: Table 2 presents the dataset of BMPs verified within Clinton, Lackawanna, Luzerne, Susquehanna, and Potter Counties through the completion of the Non-Intrusive BMP Verification procedure from April 2022 to March 2023. All practices listed above were verified based upon the visual indicator checklists outlined within the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report. Practices verified consisted of Grass Nutrient Exclusion Area on Watercourse (RI-7), Grass Buffer on Watercourse (RI-8), Forest Nutrient Exclusion Area on Watercourse (RI-9), Forest Buffer on Watercourse (RI-10), Barnyard Clean Water Diversion (RI-16), and Watering Trough (RI-18).

Table 3

Aerial Identification Metrics

Code	Resource Improvement Practice Name	Aerial Identification Metrics
<u>RI-1</u>	Dry Waste Storage Structure	~
<u>RI-2</u>	Animal Compost Structure	~
<u>RI-3</u>	Alternative Crop/Switchgrass	~
<u>RI-4A</u>	Watercourse Access Control-Narrow Grass	~
<u>RI-4B</u>	Watercourse Access Control-Narrow Trees	~
<u>RI-5</u>	Watercourse Access Control-Grass	~
<u>RI-6</u>	Watercourse Access Control-Trees	~
<u>RI-7</u>	Grass Nutrient Exclusion Area on Watercourse	37
<u>RI-8</u>	Grass Buffer on Watercourse	<u>26</u>
<u>RI-9</u>	Forest Nutrient Exclusion Area on Watercourse	<u>120</u>
<u>RI-10</u>	Forest Buffer on Watercourse	<u>614</u>
<u>RI-11</u>	Vegetative Environmental Buffer for Poultry-Grass	~
<u>RI-12</u>	Vegetative Environmental Buffer for Poultry-Trees	<u> </u>
<u>RI-13</u>	Conversion to Pasture	<u> </u>
<u>RI-14</u>	Conversion to Hayland	~
<u>RI-15</u>	Rotational Grazing	~
<u>RI-16</u>	Barnvard Clean Water Diversion	<u>101</u>
<u>RI-17</u>	Water Control Structure	~
<u>RI-18</u>	Watering Trough	5
	Total Practices Identified Via Aerial Imagery	<u>1007</u>

Note: Table 3 presents the dataset of BMPs identified via aerial imagery within Clinton, Lackawanna, Luzerne, Susquehanna, and Potter Counties through the completion of the Non-Intrusive BMP Verification procedure from April 2022 to March 2023. All practices listed above were identified based upon the visual indicators outlined for aerial desktop analysis. Practices identified consisted of Grass Nutrient Exclusion Area on Watercourse (RI-7), Grass Buffer on Watercourse (RI-8), Forest Nutrient Exclusion Area on Watercourse (RI-9), Forest Buffer on Watercourse (RI-10), Barnyard Clean Water Diversion (RI-16), and Watering Trough (RI-18).

Page 43 of 76

Table 4

<u>Quality</u>	Assurance Verification Metrics	
<u>Code</u>	Resource Improvement Practice Name	Aerial Identification Metrics
<u>RI-1</u>	Dry Waste Storage Structure	<u> </u>
<u>RI-2</u>	Animal Compost Structure	~
<u>RI-3</u>	Alternative Crop/Switchgrass	~
<u>RI-4A</u>	Watercourse Access Control-Narrow Grass	~
<u>RI-4B</u>	Watercourse Access Control-Narrow Trees	~
<u>RI-5</u>	Watercourse Access Control-Grass	~
<u>RI-6</u>	Watercourse Access Control-Trees	~
<u>RI-7</u>	Grass Nutrient Exclusion Area on Watercourse	4
<u>RI-8</u>	Grass Buffer on Watercourse	<u>6</u>
<u>RI-9</u>	Forest Nutrient Exclusion Area on Watercourse	<u>6</u>
<u>RI-10</u>	Forest Buffer on Watercourse	<u>46</u>
<u>RI-11</u>	Vegetative Environmental Buffer for Poultry-Grass	~
<u>RI-12</u>	Vegetative Environmental Buffer for Poultry-Trees	~ ~
<u>RI-13</u>	Conversion to Pasture	~ ~
<u>RI-14</u>	Conversion to Hayland	~
<u>RI-15</u>	Rotational Grazing	<u>~</u>
<u>RI-16</u>	Barnvard Clean Water Diversion	14
<u>RI-17</u>	Water Control Structure	~
<u>RI-18</u>	Watering Trough	5
	Total Practices Identified Via Aerial Imagery	81

Note: Table 4 presents the dataset of BMPs verified through the completion of the Quality Assurance Non-Intrusive BMP Verification procedure from June 2023 to August 2023. All practices listed above were verified based upon the visual indicator checklists outlined within the Chesapeake Bay Program RI Practice Definitions and Verification Visual Indicators Report and on-site verification methodology. Practices verified consisted of Grass Nutrient Exclusion Area on Watercourse (RI-7), Grass Buffer on Watercourse (RI-8), Forest Nutrient Exclusion Area on Watercourse (RI-9), Forest Buffer on Watercourse (RI-10), Barnyard Clean Water Diversion (RI-16), and Watering Trough (RI-18).

Page 45 of 76

Page 46 of 76

Figures		•	Formatted: Font: 11 pt, Bold
igure 1.			Formatted: Default, Centered, Line spacing: single
Non-Intrusive BMP Verification – Survey 123 Online D	ata Form Examplosa		Formatted: Font: (Default) Arial, 11 pt, Bold
rall Form Questions	Existing Resource Concerns and Future BMP Opportunities	- \	Formatted: Font: 11 pt, Bold
Basic Information	E Is the landowner observing/experiencing any types of resource issues on your land?		Formatted: Default, Indent: First line: 0", Line spacing: single
County	la Vea		Formatted: Underline
-Please solest-	○ Ne		
Is the Landowner Available?	is the landowner interested in learning about other BMPs?	4	Formatted: Indent: First line: 0"
() Yes	k Vm		
() Ne	O Ne		
Is a Non-Primary Participant Available?	Beck Next Page 2 of 4		
O %a	Environmential BMP Verification Form		
() Ns.	<u>Plan</u> Is there an existing plan?		
Landowner Name	(a) %		
	0		
Address	Related Plan (plan types)		
Find address or place	🔿 Varuel Unigeneed Far		
	O NurserNergerer*ar		
	O Apilitian		
	C Charger within Plant. Citype		
En - 452 Gamma LICE MOLTEL VICE MAL	Planin spacify		
(1). Lat: Lon:			
Location Address	Plart & (é available)		
	Acree		
Home Phone			
	Plan Writer		
Cell Phone	O #000		
544-	() inca		
Email	C MatchesWeb-Caracter		
	Private Plan Writer/Consultant:		Formatted: Tab stops: 5.79", Left
Next Fage 1 of 4			

Page 47 of 76

Release Needed	Environmental BMP Verification Form
O Vas	BMP Selection
O No	Varification Form Type
Type of Release Signed	-Picese select-
	Practice
O PriesOP	
() Ober	
Dther:	
Significant Dates	
mplemented On:	
II MMBDYYYY	
Planned On:	
MWDD/YYY	
inventory Evaluation On:	
MWDD/YYY	
Surveyed On:	
I MMDDYYYY	
Design Approved On:	
I MWDD/WYY	
mplemented Cost	
Additional Notes	
235/	
4359	

Page 48 of 76

Riparian Forest Buffer	10' minimum average for width of buffer.
Practice Subtype	0
REP Porce: Nutrion: Exclusion Arcs on Wetercourse (10:34)	○ №
51-10 Fernal Suffer on Wateneourse (321+)	O NA
8-12 Environmental Buffer for Pauloy	Overland/sheet flow through buffer is maximized (no concentra flow)
Now was this BMP Implemented?	⊖ %
NRCS	O Na
Growing Greener	0.82
Landamar	Btructural measures are present where vegetation practice is in to compolerosion.
GrantAvard	0 Xm
Cther	O N=
Funding Date:	() NA
MMIDS/WW	RI-9: 101-84" Width Nutrient Exclusion Area
Implemented Date:	Length Feet:
I MM/DD/WWY	
Implemented Cost	Wildth Foot:
Location Notes	Mazcurac
	(acres of buffer OR watercourse subtype - NOT both)
	Implemented Amount
	255,/ Acres of Riperian Forest Buffer
Dominant vegetation (>50% canopy cover) consists of existing, naturally regenerated, or planted trees and/or shrubs.	b ₁
0	Acres of Forest Buffer on Watercourse
O No	<i>b</i> ₁
O NA	Acres of Forest Nutrients Exclusion Area on Watercourse (Narro

Private Plan Writer/Consultant:

is this a SMP re	overification?	
0 ***		
O N=		
BMP Photo 1		
	Dimp image have ar solars image	٦
8MP Photo 2		
	Drog image have an acless image	6

Perameters for Renewed Credit?

1an Ho	rest Bu	Her - Prop	er OBM?

Yes		
No		

** If recording Subtype of BMP on this form, please use the space below to note any of the BMPs described on this form that are eligible for nanewed creatif. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.⁵⁴

Subtype: Forest Buffer on Watercourse - Proper O&M?

0	'lta	
	Ne	

ubtype: Forest Nutrient Exclusion Area on Watercourse (Narrow) Proper O&M?

	Yea			
0	Ne			

Page 50 of 76

Practice Ruleypie Image: Name of States and Sta	pincentrated
Exception of the second and second and the sec	oncentrated
K-12 Environment Buffer to Pouloy How was this BMP (mplemented? Inc. Inc.	oncentrated
How was this BMP Implemented?	oncentrated
Graning Graner	
Lenderner Structural measures are present where vegetation pred to control evasion.	tice is insufficient
Granikund Vin	
□ Cher	
Funding Dates:	
MALCONNY RU10: 35'+ Width Buffer	
Implemented Date: Length Feet:	
III MALODYYYY	
Implemented Cost Wildth Feet:	
Location Notes Measures	
(acres of buffer OR watercourse subtype - NOT both)	
Implemented Amount	
Dominant vagetation (>50% canopy cover) consists of axioting. Acres of Riparian Forest Buffer naturally regenerated, or planted teses and/or chulus.	
Vie Acres of Forest Buffer on Watercourse	
Acres of Porest Buffer on Watercourse	
NVA Acres of Forest Nutriants Exclusion Area on Watercours	e (Narrow)
41	

Page 51 of 76

this				

0 %		
O N#		
BMP Photo 1		
	 ·····	

Drop image have an asless image

BMP Photo 2

Drop imaga hara ar salast imaga

Parameters for Renewed Credit?

Riparian Forest Buffer - Proper O&M?

0	Yes			
0	Ne			

*** If recording Subtype of BMP on this form, please use the space below to note any of the BMP described on this form that are eligible for renewed credit. Also be sure to note any of the BMP described on this form that are NOT eligible for renewed credit.**

Subtype: Forest Buffer on Watercourse - Proper O&M?

() Yes	
○ N•	

Subtype: Forest Nutrient Exclusion Area on Watercourse (Narrow) -Proper O&M?

0	Yes		
	Ne		

Notes

		255/2

Page 52 of 76

 Environmental BMP Verification Form	Width is 2.55° if receiving dissolved contaminants (e.g. nutrients, particides).
Riparian Herbaceous Cover / Riparian Grass Buffer	O Yea
Practice Subtype	0.4
Ri-7 Grass Nutriers Englains Area on Watersourus (10-34)	O Na
Rh & Greas Suffer an Watersource (25'4)	O NA
R111 Environmental Euller for Paulity	Overland flow through buffer is maintained as sheet flow.
How was this BMP Implemented?	○ Ym
nes .	O Ne
Graving Disence	0
Cure Anerd	All excessive sheat-rill and concentrated flow are controlled in areas immediately adjecent & up gradient of buffer, before entering.
	O Yee
Funding Date:	O N=
	O NA
10 MM/COPPY	
Implemented Date:	No livestock are present no have access.
3 MMCC/1997	○ ¥••
Implemented Cost	O Ne
	0 NA
Location Notes	Plant spacies are native (preferred), or introduced and non-invasive.
	with stiff stems and high stem density.
238.0	O Yes
Horizontal buffer width ≥ 10°, measured perpendicular to top-of-bank intermittent stream, ditch or tidal area.	O Na
0	O MA
() No.	Plants are compatible in growth rate, tolerant of flooding/saturation ar shade.
O NIA	() ^у в
	⊖ Na
	() NA

Minimum of 75% perennial grass cover is present.	Parameters for Renewed Oredit?
	Riparian Herbaceous Cover/Riparian Grass Buffer - Proper O&M?
○ N=	0 vu
() NA	O Na
RF-7: 101-941 Width Nutrient Exclusion Area	** If recording Subtype of BMP on thic form, plazes use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to none any of the BMPs described on this form that are NOT eligible for renewed credit."*
Langth Feet:	Subtype: Grazz Buffer on Watercourse - Proper O&M?
Width Feet) v=
Width Feet:	
	0
Measures	Subtype: Grazz Nutrient Exclusion Area on Watercourse (Narrow) - Proper O&M?
(screz of buffer OR watercourse subtype - NOT both)	_ \s
Implemented Amount	O N#
Acres of Riparian Herbaceous Cover/Riparian Grass Buffer	
42	Notes
Acres of Grass Buffer on Watercourse	
41	251
Acres of Grazz Nutrients Exclusion Area on Watercourse (Narrow	
42	
Is this a BMP reverification?	
O v=	
O No	
EMP Photo 1	
Drop Image have or acteed Image	
BMP Photo 2	
Drop imaga hara ar aslaat imaga	

Environmental BMP Verification Form	Width is 2 55' if receiving dissolved contaminants (e.g. nut pecticides).
Riparian Herbaceous Cover / Riparian Grass Buffer	
Practice Subtype	O Ym
8-7 Greas Nutrient Basilusian Area an Watersourse (10184)	O N#
St-8 Gireas Buffer on Watercourse (35*+)	O NA
0-11 Devicemental Buller for Pauloy	Overland flow through buffer is maintained as sheet flow.
How was this BMP Implemented?	O Yes
NMC3	O Na
Graning Graner	O NA
Landaurer	All excessive sheet-rill and concentrated flow are controlle
Grent Anerel	immediately adjacent & up gradient of buffer, before ente
C Onor	<u>О</u> та
	O No
Funding Date:	O NA
MMOD/YYYY	
Implemented Date:	No livestock are present no have access.
E MMODYYYY	O 1/14
Implemented Cost	○ N=
	O NA
Location Notes	Plant species are native (preferred), or introduced and non
	with stiff store and high store density.
	O Ya
231.4	
Horizontal buffer width $\gtrsim 10^\circ,$ measured perpendicular to top-of-bank	O Na
intermittent stream, ditch or tidal area.	O NA
О Уса	
() Na	Plantz are compatible in growth rate, tolerant of flooding/s shade.
O NA	ет ()
	() No

linimum of 75% perennial grass cover is present.	Parameters for Renewed Oredit?	
○ Y=a	Riparian Herbaceous Cover/Riparian Grass Buffer - Proper O&M?	
O Ne	о [,] ти	
() NIA	○ N8	
H8: 35'+ Width Buffer	²⁴ If recording Subtype of BMP on this form, plasse use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit. ³⁵	
angth Feet:		
-	Subtype: Grass Buffer on Watercourse - Proper O&M?	
	O %**	
/idth Faat:	0.1	
Measures	Subtype: Grass Nutrient Exclusion Area on Watercourse (Narrow) - Proper O&M ?	
cres of buffer OR watercourse subtype - NOT both)	O <i>™</i>	
plemented Amount	O No	
crez of Riparian Herbaceous Cover/Riparian Grass Buffer	Notes	
cres of Grass Buffer on Watercourse		
egi	255,5	
cres of Grass Nutrients Exclusion Area on Watercourse (Narrow		
this a BMP reverification?		
○ ^v ex		
○ N=		
MP Photo 1		
Drop image hore or select image		
MP Photo 2		
Dag image have as asless image		

Page 56 of 76

Environmental BMP Verification Form	Gut
Wetering Facility	
Practice Subtype	
Ki, 16 Rempirel Clean Water Diversion	
O 85-17 Water Cannol Soveture	
O T-10 Wearing Tough	Dri
How was this BMP Implemented?	
1903	
Crowing Grooner	
Landance -	Gu
Grantuloural	end
Citer	
Funding Date:	
Manada www.	
Implemented Date:	Do
C Marconvvv	
Implemented Cost	
Location Notes	The
	288,0
Surface outlet is stable; downspouts have elbow and dissipation de directed away from buildings; as appropriate.	
O %=	
0 Ne	Do
0	

ter-less system has stone-filled, collection trench under entire roof $\lim_{n\to\infty} \min_{n\to\infty} 2n^n$

te: width 2 24", depth 2 24".
Vee
Ne
NA

Drip line stone extends along side of and over pipe.

Vee		
Ne		
2004		

iutter is K-style, half-round or box-type on good-condition vertical socia board, free floating on supports, and 2.5" top width. Roof rafts ords are sound

0	14a
	Na
	N/A

rwnspout avoids mix with waste.

122	
Na	
WA	

he system is sound and functioning.

O Ne
0 14
O N/4

Downspouts are securely fastaned © top & bottom, with intermediate supports ≤ 10°, installed appropriately.

O ¥==		
O N#		

Form Question	ons				Forma
ed					_
			Environmental BMP Verification Form		
Gutter & down:	pouts are protected from livestock. Otherwise m	ade of	Parameters for Renewed Credit?		
steel pipe, Sch4	0, or similar.		Watering Facility - Proper O&M7	-	
O Yea			O Yea		
○ Ne			0 Na		
O NA				•	
			""If recording more than 1 BMP on this form, please use the space below. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit."		
	anoff is directed away from barnyard area.		Subtype: Watering Trough - Proper O&M?		
O *••					
○ Na			O Va		
() NA		_	0 N=		
			Notes		
Number of Syst	wms:				
Implemented A	mount		293,0		
# of Watering F	aciities				
u^{\dagger}					
# of Watering T	roughs				
ψ^{\dagger}					
Is this a BMP re	userie sting?				
() Yau					
○ Ne					
BMP Photo 1:					
	Drop image here or solect image	Ø			
L					
PMD Photo 2.					
BMP Photo 2:	Drog imago horo or soloct imago	Ø			

Page 58 of 76

Environmental BMP Verification Form	Practice Meets Visual Indicators:		
Watering Facility	Watering Facility		
Practice Subtype			
Pi-16 Semjerd Cleen Water Diversion	Wetcring Trough		
O R-17 Neter Control Soucture	Implemented Amount		
A-15 Westing Tough	# of Watering Facilities		
How was this BMP implemented?	22		
NRC5	# of Watering Troughs		
	42		
Graving Breener	Ventied Amount		
Landowner			
Crenc Award	# of Watering Facilities		
Coher			
	e of Watering Troughs		
Funding Date:	72		
III MARDOWAY	BMP Photo 1:		
Implemented Date:	Drag image here or adjust image		
I MWDDYYYY	BMP Photo 2:		
Implemented Cost	Drep image here or select image		
	Perameters for Renewed Credit?		
Location Notes	Watering Facility - Proper O&M7		
	0 Ven		
	0.1		
294,0	0 N#		
Implemented Amount			
# of Watering Facilities	**If recording more than 1 BMP on this form, please use the space below. Also be sure to note any of the BMPs described on this form that are NOT eligible for randwad credit.**		
	Subtype: Watering Trough - Proper O&M?		
# of Watering Troughs	er ()		
y ⁰ 1	0 Nm		
Is this a BMP reverification?	-		
O •••			
O Ne			

Page 59 of 76

	 Formatted: Tab stops: 5.92", Left
	 Formatted: Tab stops: 5.54", Left
If recording more than 1 BMP on this form, please use the space below. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.	
Subtype: Watering Trough - Proper O&M?	
O Yes	
O Ne	
Notas	

Page 60 of 76

Environmental BMP Verification Form	Width is ≥ 35' if receiving dissolved contaminants (e.g. nutrients, pesticides).	
Riparian Herbaceous Cover / Riparian Grass Buffer		
Practice Subtype	Vea	
RI-7 Greas Nutrient Exclusion Area on Watercourse (10'-34')	O Ne	
RI-8 Greas Buffer on Wetercourse (33'+)	○ N/A	
RI-11 Environmental Buffer for Poultry	Overland flow through buffer is maintained as sheet flow.	
How was this BMP Implemented?	O Yes	
NRCS	O Ne	
Graning Greener	O N/A	
Landawner	All excessive sheet-rill and concentrated flow are controlled in areas immediately adjacent & up gradient of buffer, before entering.	
Grent Award	Ves	
Other	○ Ne	
Funding Date:	○ N/A	
MM/DD/YYYY	No livestock are present no have access.	
Implemented Date:	Ves	
MM/DD/YYYY		
Implemented Cost		Formatted: Tab stops: 2.48", Left
Location Notes	Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density.	
	O Yes	
255/	O Ne	
Horizontal buffer width 2 10', measured perpendicular to top-of-bank intermittent stream, ditch or tidal area.	O N/A	
RI-7, Form Questions	Plants are compatible in growth rate, tolerant of flooding/saturation and shade.	Formatted: Underline
U Ne	Ves	
○ N/A	O Ne	

() N/A

Page 61 of 76

Minimum of 75% perennial grass cover is present.	Parameters for Renewed Credit?	
) Yes	Riparian Herbaceous Cover/Riparian Grass Buffer - Proper O&M?	
O Ne	O Yea	
O NA	O No	
RI-7: 10'-54' Width Nutrient Exclusion Area	** If recording Subtype of BMP on this form, please use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.**	Formatted: Tab stops: 5.23", Left
Lengur Peet.	Subtype: Grass Buffer on Watercourse - Proper O&M?	
Width Feet:	O Yes	
	O Ne	
Measures	Subtype: Grass Nutrient Exclusion Area on Watercourse (Narrow) - Proper O&M?	
(acres of buffer OR watercourse subtype - NOT both)	Vea	
Implemented Amount		
Acres of Riparian Herbaceous Cover/Riparian Grass Buffer	O Ne	
12 ²	Notes	
Acres of Grass Buffer on Watercourse		
2 ⁰	255/	
Acres of Grass Nutrients Exclusion Area on Watercourse (Narrow		
<i>v</i> ²		
Is this a BMP reverification?		
Vea		
Ne Ne		
BMP Photo 1		
RI-7, Form Questions		Formatted: Underline
BMP Photo 2		
Drep image here er solest image		

But Wallingtown Card With the State of a first and in a finding Bracess delays In the State of a first and in a finding In the State of A first and in a first and first and in a fir		Width is 2 35' if receiving dissolved contaminants (e.g. nutrients,	
Prestas skatype Image: Instrument (19:10) Formatted: Tab stops: 5.12", Left Formatted: Tab stops: 5.1", Left Formatted: Tab stops: 5.1", Left<			
Image: Intervention of the set intervent (11:02) Image: Intervent (11:02) <		O Yes	
In the State Lumber durate is as as iterace or (10.3) In the State Lumber durate is as as iterace or (10.3) In the State Lumber durate is as as iterace or (10.3) In the State Is an iterace of Islate Isl		Ne Ne	
I h Bit Muncer (BI-) Conduct filter through halffar is proteined as short flow. Formatted: Tab stops: 5.12', Left Formatted: Tab stops: 5.12', Left Formatted: Tab stops: 5.12', Left Formatted: Tab stops: 5.12', Left Formatted: Tab stops: 5.12', Left Formatted: Tab stops: 5.11', Left Formatted: Tab st	RI-7 Gress Nutrient Exclusion Area on Watercourse (10'-34')		
Image: State in the state is the	RI-8 Gress Buffer on Wetercourse (35'+)	○ N/A	
Image: State in the SMP implemented? Implemented Other: State in the SMP implemented? Implemented Other: State in the SMP implemented Other implement	RI-11 Environmental Buffer far Paultry	Overland flow through buffer is maintained as sheet flow.	Formatted: Tab stops: 5.12", Left
 was was			Formatted: Tab stops: 5.41", Left
Image: Image	low was this BMP Implemented?		
devector	NRCS		
is networe immediately adjacent & up gradient of buffer, before entering. ibere Alered ibere Alered <td>Grawing Greener</td> <td>O NA</td> <td></td>	Grawing Greener	O NA	
• Unit index • Conv • International Date: • International Date: • International Date: </td <td>Landonner</td> <td>All excessive sheet-rill and concentrated flow are controlled in areas immediately adjacent & up gradient of buffer, before entering.</td> <td></td>	Landonner	All excessive sheet-rill and concentrated flow are controlled in areas immediately adjacent & up gradient of buffer, before entering.	
Cuese Funding Date: Implemented Date: Implemented Date: Implemented Cost Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cost Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cost Plant are compatible in growth rate, tolerant of flooding/saturation and shades. Implemented Cost	Grant Award	O Vm	
iunding Date: iiii MADDOVYNY No Investock are present no have access. ive ive No Investock are present no have access. ive ive Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. ocation Notes Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. ocation Notes Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. ocation Notes Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. ocation Notes Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. ocation Notes Plant species are compatible in growth rate, tolerant of flooding/sturation and stade. or vis Plant are compatible in growth rate, tolerant of flooding/sturation and stade. or vis	Other	O Ne	
MMDDUTYFY mplemented Date: IMMDDUTYFY Implemented Cott Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Implemented Cott Implemented Cott Implemented Cott Implemented Cott Implemented Cott I	Funding Date:	O N/A	
Implemented Date: Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost Implemented Cost </td <td></td> <td>No livestock are present no have access.</td> <td></td>		No livestock are present no have access.	
mplemented Cost mplemented Cost Nu Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density. Vua I-8 Form Questions Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Vua Vua	mplemented Date:	Via Via	
Les Form Questions Vas Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Vas Vas Vas Vas Vas Vas	MM/DD/YYYY	O Ne	
Location Notes Location Notes 255, Ves 1-8 Form Questions Ves Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Ves	mplemented Cost	O N/A	
Location Notes Ves		Plant species are native (preferred), or introduced and non-invasive, with stiff stems and high stem density.	
Image: State	Location Notes		
I-8 Form Questions Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Ves Ves Ves Ves Ves		0 Yza	
Item Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Formatted: Underline Yes Yes		O Ne	
Plants are compatible in growth rate, tolerant of flooding/saturation and shade. Vrss		O N/A	
O Yes	I-8 Form Questions	Plants are compatible in growth rate, tolerant of flooding/saturation and	Formatted: Underline
	O Yes	shade.	
	Ne Ne	O Yes	
○ Ne		O Ne	
	O N/A	O N/A	

Minimum of 75% perennial grass cover is present.

Minimum of 75% perennial grass cover is present.	Parameters for Renewed Credit?	
O Yea	Riparian Herbaceous Cover/Riparian Grass Buffer - Proper O&M?	
O Ne	O Yea	
○ N/A	O Ne	
RI-8: 35'+ Width Buffer Length Feet:	** If recording Subtype of BMP on this form, please use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to note any of the BMPs described on this form that re NOT eligible for nenewed credit.**	
	Subtype: Grass Buffer on Watercourse - Proper O&M?	
Width Feet:	O Yes	
	○ Ne	
Measures		
(acres of buffer OR watercourse subtype - NOT both)	Subtype: Grass Nutrient Exclusion Area on Watercourse (Narrow) - Proper O&M?	
Implemented Amount	Vea	
Acres of Riparian Herbaceous Cover/Riparian Grass Buffer	O Ne	
2	Notas	
Acres of Grass Buffer on Watercourse		
12 ²		
Acres of Grass Nutrients Exclusion Area on Watercourse (Narrow	255/	
Q ²		
Is this a BMP reverification?		
Ves		
○ Ne		
BMP Photo 1		
RI-8 Form Questions		Formatted: Underline
		i offiatted. Ondefilite
Drag image here or select image		

Environmental BMP Verification Form	Perpendicular distance from top-of-bank of stream, ditch or tidal area 2	
<u>Riparian Forest Buffer</u>	10' minimum average for width of buffer.	
Practice Subtype	Vea	
RI-9 Forest Nutrient Baslusion Area on Watersourse (10-341)	O Ne	
RI-10 Perest Buffer en Watersourse (35'+)		Formatted: Tab stops: 5.83", Left
RI-12 Environmental Buffer for Poultry	Overland/sheet flow through buffer is maximized (no concentrated flow)	
How was this BMP Implemented?	O Yes	
NRCS	O Ne	
Graning Greener		Formatted: Tab stops: 5.15", Left
Landamer	Structural measures are present where vegetation practice is insufficient	
Grent Awerd	to control erosion.	
Coher	O Yes	
Funding Date:	O Ne	
	○ N/A	
Implemented Date:	RI-9: 10'-34' Width Nutrient Exclusion Area	
	Length Feet:	
Implemented Cost		
	Width Feet:	
Location Notes		
	Measures	
255/	(acres of buffer OR watercourse subtype - NOT both)	
RI-9 Form Questions	Implemented Amount	Formatted: Underline
· · ·	Acres of Riparian Forest Buffer	
○ Yes	2	
○ Ne	Acres of Forest Buffer on Watercourse	
O NA	4 ²	
	Acres of Forest Nutrients Exclusion Area on Watercourse (Narrow)	
	2 ¹	
	•	Formatted: Right
	Page 65 of 76	

Is this a BMP reverification?

) Yea	
O Ne	
BMP Photo 1	
Drep imege here er seless imege	
BMP Photo 2	
Drep inegs here ar select inegs	
Parameters for Renewed Credit?	
Riparian Forest Buffer - Proper O&M?	Formatted: Centered
O Yes	
O Ne	
** If recording Subtype of BMP on this form, please use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.**	
Subtype: Forest Buffer on Watercourse - Proper O&M?	
O Yes	
O Ne	
Subtype: Forest Nutrient Exclusion Area on Watercourse (Narrow) - Proper O&M?	
O Yea	
O Ne	
Notes	
II-9 Form Questions	Formatted: Underline
255//	

Environmental BMP Verification Form	Perpendicular distance from top-of-bank of stream, ditch or tidal area ≥ 10° minimum average for width of buffer.	
<u>Riparian Forest Buffer</u>	Vra	
Practice Subtype	○ Ne	
RI-9 Fercas Nutrians Esclusion Area on Wetercourse (101341)		
RI-10 Perest Buffer on Wetercourse (35'+)	O N/A	
RI-12 Environmental Buffer for Paultry	Overland/sheet flow through buffer is maximized (no concentrated flow)	
How was this BMP Implemented?	O Yea	
NRCS	Ne Ne	
Grawing Greener	O N/A	
Landanner	Structural measures are present where vegetation practice is insufficient to control erosion.	
Grent Award	O Vea	
	O Ne	Formatted: Tab stops: 1.76", Left
Funding Date:	○ N/A	
MM/DD/YYYY	RI-10: 35'+ Width Buffer	
Implemented Date:	Length Feet:	
I MMDD/YYYY		
Implemented Cost	Width Feet:	
Location Notes	Measures	
	(acres of buffer OR watercourse subtype - NOT both)	
255/	Implemented Amount	
RI-10 Form Questions	Acres of Riparian Forest Buffer	Formatted: Underline
naturany regenerated, or pranted trees and/or simulos.	12 ¹	
Vea	Acres of Forest Buffer on Watercourse	
○ No	23	
O N/A	Acres of Forest Nutrients Exclusion Area on Watercourse (Narrow)	
	-12 ²	
	•	Formatted: Centered
	Deve 07 - (70	
	Page 67 of 76	

Is this a BMP reverification?

No No	🔘 Yea	
3MP Photo 1	O No	
	MP Photo 1	

Drep imege here or select imege	0
L	
BMP Photo 2	

·····	
Drop image here or select image	0
L	

Parameters for Renewed Credit?

Riparian Forest Buffer - Proper O&M?

(0	Yes	
(0	No	

** If recording Subtype of BMP on this form, please use the space below to note any of the BMPs described on this form that are eligible for renewed credit. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.**

Subtype: Forest Buffer on Watercourse - Proper O&M?

O Yea			
O No			

Subtype: Forest Nutrient Exclusion Area on Watercourse (Narrow) -Proper O&M?

-	
()	Yes

O No

Notes

RI-10 Form Questions

255//

Formatted: Underline

Page 68 of 76

Gutter-less system has stone-filled, collection trench under entire roof drip line: width $\geq 24^\circ$, depth $\geq 24^\circ$.
drip line. width 2 24 , depth 2 24 .

O Yes		
O Ne		
() N/A		

Drip line stone extends along side of and over pipe.

0	Yea		
0	Ne		
0	N/A		

Gutter is K-style, half-round or box-type on good-condition vertical fascia board, free floating on supports, and $\gtrsim 5^\circ$ top width. Roof rafter ends are sound.

O Yea

O N/A

O Yea

O No

() N/A

Yes
 No
 N/A

Yes
 No
 N/A

ce

O Ne

Downspout avoids mix with waste.

The system is sound and functioning.

Formatted: Tab stops: 2.65", Left

Funding Date:

Other

Practice Subtype

RI-16 Bernyerd Cleen Weter Diversion
 RI-17 Weter Central Structure

RI-18 Wetering Trough

NRCS

Growing Greener

Landowner

Grant Award

How was this BMP Implemented?

MM/DD/YYYY

Implemented Date:

MM/DD/YYYY

Implemented Cost

Location Notes

RI-16 Form Questions

Watering Facility

unacted array nom buildings, as appropriate.

O Yea		
O No		
O N/A		

Downspouts are securely fastened @ top & bottom, with intermediate supports \leq 10', installed appropriately.

Formatted: Underline

Page 69 of 76

Gutter & downspouts are protected from livestock. Otherwise made of teel pipe, Sch40, or similar.	Parameters for Renewed Credit?		
O Yea	Watering Facility - Proper O&M?		
	O Yes		
Ne Ne	O Ne		
O N/A			
Clean surface runoff is directed away from barnyard area.	**If recording more than 1 BMP on this form, please us below. Also be sure to note any of the BMPs described are NOT eligible for renewed credit.**	e the space on this form that	
O Yes	Subtype: Watering Trough - Proper O&M?	-	Formatted: Tab stops: 5.88", Left
O Ne	O Yes		
() N/A	O No		
lumber of Systems:	Notes	4	Formatted: Tab stops: 1.46", Left
umber of systems:			Formatted. Tab stops. 1.40 , Leit
nplemented Amount		255//	
of Watering Facilities			
2			
of Watering Troughs			
ų ²			
: this a BMP reverification?			
O Yea			
O Ne			
IMP Photo 1:			
Drep image here or select image			
-16 Form Questions			Formatted: Underline
Urap mega nara a salasi mega			
		-	Formatted: Tab stops: 1.99", Left
			Formatted: Tab stops: 6.02", Left
		-	Tormatten. Tab stops. 0.02 , Lett
	Pac	ge 70 of 76	

Environmental BMP Verification Form	How was this BMP Implemented?	
Watering Facility	NRCS	
Practice Subtype	Grewing Greener	
RI-16 Bernyerd Clean Weter Diversion		
RI-17 Weter Central Structure	Lendenner	
RI-18 Wetering Trough	Grent Awerd	
There is an adequate water supply?	Cther	
Vra	Funding Date:	
O No	MM/DD/YYYY v	
	Implemented Date:	
O N/A	□ MM/DD/YYY	
Area around trough does not create a resource concern?	Implemented Cost	
O Vea		
O Ne	Location Notes	
O N/A		
Automatic water level control is functioning without overtopping?	255.//	
) Yes	Implemented Amount	
O Ne	# of Watering Facilities	
O N/A	- 2 ³	
Overflow is piped to acceptable outlet?	# of Watering Troughs	
) Yes	23	
Ne Ne	Is this a BMP reverification?	
○ N/A	O Yes	
RI-18 Form Questions	Ne Ne	Formatted: Underline
regulations?		Formatted. Ondenine
Vea	BMP Photo 1:	
	Drop image here or select image	Formatted: Tab stops: 1.99", Left
	BMP Photo 2:	romated. Tab stops. 1.55 , Leit
○ N/A	Drop image here ar select image	
	•	Formatted: Tab stops: 2.2", Left
		· · · · · · · · · · · · · · · · · · ·

Parameters for Renewed Credit?

Parameters for Renewed Credit?		
Watering Facility - Proper O&M?		
O Yes		
O Ne		
If recording more than 1 BMP on this form, please use the space below. Also be sure to note any of the BMPs described on this form that are NOT eligible for renewed credit.		
Subtype: Watering Trough - Proper O&M?		
O Yea		Formatted: Tab stops: 5.31", Left
O Ne		
Notes		
255,/		
434/7		
RI-18 Form Questions		Formatted: Underline
		Formatted: Centered, Indent: First line: 0.5"
Non-Intrusive BMP Verificat	ion – Survey 123 Online Data Form Example	
	Page 72 of 7	6

Environmental BMP Verification Form	•	Formatted: Centered
Basic Information County	4-	Formatted: Centered, Indent: First line: 0.5"
-Plesse select-		
Is the Landowner Available?		
o vea		Formatted: Centered
○ No	Existing Resource Concerns and Future BMP Opportunities Is the landowner observing/experiencing any types of resource issues	
	on your land?	
Is a Non-Primary Participant Available?	O Yes	
O Yes	○ No	
○ No	Is the landowner interested in learning about other BMPs?	
Landowner Name	O Yes	
	○ No	
Find address or place	Back Next Page 2 of 4	
Exr. HEFE, Germin, USDS, 1/IGA, EPA, USDA, 1/IPS Pointered by Err (1). Lat: Lon:		
Location Address	Plan	
	Is there an existing plan?	
Home Phone		
Home Phone	Is there an existing plan?	
Home Phone Cell Phone	Is there an existing plan?	
	Is there an existing plan?	
	Is there an existing plan?	
Cell Phone	Is there an existing plan?	
Cell Phone	Is there an existing plan?	
Cell Phone Email	Is there an existing plan?	
Cell Phone Email Nex Page 1 of 4 BMP Selection	Is there an existing plan?	
Cell Phone Email Mex Page 1 of 4 BMP Selection Verification Form Type	Is there an existing plan? Ves No Back Page 3 of 4 Dominant vegetation (>50% canopy cover) consists of existing,	
Cell Phone Email Nex Page 1 of 4 BMP Selection	Image: second	
Cell Phone	Is there an existing plan? Visit No Back Next Page 3 of 4 Dominant vegetation (>50% canopy cover) consists of existing, naturally regenerated, or planted trees and/or shrubs. Ves	
Cell Phone Email Email Nex Page 1 of 4 DMP Selection Verification Form Type Riparian Forest Buffer (RI-9, RI-10, R • Prescribed Grazing (RI-15)	Is there an existing plan? ves No Back Page 3 of 4 Dominant vegetation (>50% canopy cover) consists of existing, naturally regenerated, or planted trees and/or shrubs. ves Ves ves	
Cell Phone Email Email Net Page 1 of 4 DEP Selection Sufficient Formst Buffer (RI-9, RI-10, R.: Prescribed Grazing (RI-15) Prescribed Grazing (RI-16), RI-10, RI-12) Prescribed Grazing (RI-15) Prescribed Grazing (RI-15) Prescribed Grazing (RI-16), RI-10, RI-12) Prescribed Grazing (RI-16), RI-10, RI-12) Prescribed Grazing (RI-16), RI-10, RI-12)	Is there an existing plan? Image: Ima	
Cell Phone Email Email Next Page 1 of 4 DEP Selection Supprise Forest Buffer (RI-9, RI-10, R • Prescribed Grazing (RI-15) Prescribed Grazing (RI-16), R • Riparian Forest Buffer (RI-9, RI-10, R • Riparian Herbaceous Cover alsa Grazs Buffer (RI-7, RI-6, RI-11)	Is there an existing plan? ves No Page 3 of 4 Deminant vegetation (>50% canopy cover) consists of existing, naturally regenerated, or planted trees and/or shrubs. Ominant vegetation (>50% canopy cover) consists of existing, naturally regenerated, or planted trees and/or shrubs. ves ves Na Page 3 of 4	
Cell Phone Email Email Next Page 1 of 4 DEP Selection Supprise Forest Buffer (RI-9, RI-10, R • Prescribed Grazing (RI-15) Prescribed Grazing (RI-16), R • Riparian Forest Buffer (RI-9, RI-10, R • Riparian Herbaceous Cover alsa Grazs Buffer (RI-7, RI-6, RI-11)	Is there an existing plan? 'yea No Back Next Page 3 of 4 Page 3 of 4 Page 3 of 4 Page 3 of 4 No Is the second	

Overland/sheet flow through buffer is maximized (no concentrated flow)

<u>Riparian Forest Buffer</u>

Practice Subtype

	RI-9 Forest Nutrient Exclusion Area on Watercourse (10'-34')
	RI-10 Forest Buffer on Watercourse (35'+)
	RI-12 Environmental Buffer for Poultry

How was this BMP Implemented?

NRCS	
Growing Greener	
Landowner	
Grant Award	
Other	

Funding Date:

MM/DD/YYYY

Implemented Date:

MM/DD/YYYY

Implemented Cost

Structural measures are present where vegetation practice is insufficient to control erosion.

Yea
 No

) N/A			

RI-10: 35'+ Width Buffer

Length Feet:

Width Feet:

Measures

(acres of buffer OR watercourse subtype - NOT both)

Implemented Amount

Acres of Riparian Forest Buffer

12³

Acres of Forest Buffer on Watercourse

12³

Formatted: Centered, Tab stops: Not at 2.8"

Page 74 of 76

Acres of Forest Nutrients Exclusion Area on Watercourse (Narrow)

Riparian Forest Buffer - Proper O&M?

O Yes			
O No			

- Formatted: Centered, Indent: First line: 0.5", Tab stops: Not at 2.8"
 Formatted: Normal, Centered, Indent: First line: 0.5", Line spacing: Double
 - Formatted: Default

Page 75 of 76